Illustrating the autocorrelation effect in T^2 control chart of Hotelling by means of geometric approach

Roberto Campos Leoni^{1,5}, Nilo Antonio de Souza Sampaio^{1,4}, Antonio Fernando Branco Costa³, José Wilson de Jesus Silva^{1,2}

¹Associação Educacional Dom Bosco, AEDB, Resende, RJ, Brazil
 ²Centro Universitário Teresa D'Ávila, UNIFATEA, Lorena, SP, Brazil
 ³Universidade Estadual Paulista, UNESP, Guaratinguetá, SP, Brazil
 ⁴Universidade do Estado do Rio de Janeiro, UERJ/FAT, Resende, RJ, Brazil
 ⁵Academia Militar das Agulhas Negras, AMAN, Resende, RJ, Brazil

Abstract— Using a geometric approach with ellipses, results warn that the autocorrelation presence reduces the T^2 chart performance, restricting the chart ability to signal a special cause that is acting in the process. A control chart is one of the main techniques of statistical control of process and using this technique means auto correlation absence among the data of measured quality characteristics. Some examples are presented to illustrate the detrimental effect of T^2 chart when autocorrelation is present in the process. This article discusses effect of correlation and autocorrelation in Hotelling T^2 chart when there are two quality characteristics X and Y, whose autocorrelation and correlation structure is represented by a VAR(1) model.

Keyword— Autocorrelation; Hotelling T^2 chart; VAR(1) model; statistical process control.

I. INTRODUCTION

The independence among observations over time is one of the basic assumptions for control charts use. Nevertheless, in some cases, quality characteristic measures of neighboring items, according to the time they were produced, may present some dependence degree among the observations. This phenomenon is called autocorrelation. According to Sullivan[1], many industrial operations of streaming present autocorrelation and one of the possible reasons is the gradual wear of critical components of process. Gani[2]states that independence hypothesis among observations of a variable can be violated by the high production rates that generate correlation and dependence among observations of neighbor products according to the manufacturing instant.

The performance of traditional control charts can be affected by autocorrelation [3].Recent studies present alternatives to monitor these types of processes. Some authors [4] proposed a control chart based on the minimum euclidean distance to detect deviations on the average in auto correlated processes. Others [5] considered the economic design of control chart ARMA, used in auto correlated processes. Franco et al. [6] used the AR(1) model to describe the oscillatory behavior of the average and showed the optimal parameters of \overline{X} chart using the Duncan model .Lee et al. [7] also used the AR(1) model to investigate the effect of oscillatory behavior of the average in the performance of \overline{X} chart with double sampling. In order to reduce the negative effect of autocorrelation on the \overline{X} chart performance, Hu et al. [8] presented a technique of systematic sampling called s-skip

With advanced technology and high production rates modern systems generated complex processes that are multidimensional, that is, many quality characteristics are measured and controlled. Pan[9] describes some of these processes that may have correlated and auto correlated observations.

The use of T^2 statistics for monitoring the mean vector in multivariate processes is suggested by Hotelling [10]. Seven decades later, Chen [11,12] showed the adaptive schemes that improve the performance of the T^2 chart. According to Hwang et al.[13], autocorrelation increases the false alarms rate, while correlation decreases the control graph power. The combined activity of autocorrelation and correlation in the performance of T^2 chart is worthy of investigation.

The aim of this article is to graphically evaluate the effect of autocorrelation in two characteristics of measurable quality X and Y when there is correlation between observations of X and Y.The VAR(1) model was

adopted to represent the structure of correlation and autocorrelation. It was considered in evaluating that the shift in the mean is the most important in the whole process and that the mean vector and the covariance matrix are known or estimated accurately.

The article is organized as following way: section 2 describes the model that represents quality characteristics when there is autocorrelation in the process; section 3 presents some characteristics of the Hotelling T^2 chart; the effect of autocorrelation in bivariate processes is discussed and evaluated in section 4 and, finally, it is concluded about the work in section 5.

II. AUTOREGRESSION MODEL AND CROSS-COVARIANCE MATRIX

The classical control procedures in multivariate processes consider the basic assumption that the observations follow a multivariate normal distribution and are independent, with mean vector $\boldsymbol{\mu}_0$ and variance-covariance matrix $\boldsymbol{\Sigma}$.

$$\mathbf{X}_{t} = \boldsymbol{\mu}_{0} + \boldsymbol{e}_{t} \qquad t = 1, 2, ..., T$$

where: \mathbf{X}_t represents observations by a vector of order p x I (p is the number of variables); e_t are independent random vectors of order p x I with multivariate normal distribution whose mean is zero and variance-covariance matrix Σ_e .

In many manufacturing processes, the independence assumption is violated. Autoregression vectors of first order - VAR(1) are used to model multivariate processes with temporal correlation among observations of the same variable and correlation among observations of different quality characteristics [14-21] The VAR(1) model is represented by:

$$\mathbf{X}_{t} - \mathbf{\mu} = \Phi(\mathbf{X}_{t-1} - \mathbf{\mu}) + \mathbf{\varepsilon}_{t} \tag{2}$$

being $\mathbf{X}_t \sim \mathbf{N}_p \left(\mathbf{\mu}, \ \Gamma \right)$ the vector of observations of dimension $(p \times 1)$ at instant t (p is the number of variables), $\mathbf{\mu}$ is the mean vector, $\mathbf{\epsilon}_t$ is a random vector with independent observations and multivariate normal distribution with zero mean and covariance matrix Σ and Φ is a matrix with autocorrelation parameters of order $(p \times p)$.

For Jarrett [3], the \mathbf{X}_t cross-correlation matrix has the following property: $\Gamma = \Phi \Gamma \Phi' + \Sigma$. After some algebraic manipulation, it is possible to obtain the relationship:

$$Vec \ \Gamma = \left(I_{p^2} - \Phi \otimes \Phi\right)^{-1} Vec \ \Sigma \tag{3}$$

where \otimes is the product operator of Kronecker and *Vec* is the operator that transforms a matrix into a vector by stacking its columns.

In order to study the effect of correlation and autocorrelation of T^2 chart, it was considered a bivariate process (p=2):

$$\Phi = \begin{bmatrix} a & 0 \\ 0 & b \end{bmatrix}; \Sigma = \begin{bmatrix} 1 & \rho \\ \rho & 1 \end{bmatrix} \tag{4}$$

From (2) and (3), it follows that:

$$\Gamma = \begin{pmatrix} \sigma_X^2 = (1 - a^2)^{-1} & \sigma_{XY} = \rho (1 - ab)^{-1} \\ \sigma_{XY} = \rho (1 - ab)^{-1} & \sigma_Y^2 = (1 - b^2)^{-1} \end{pmatrix}$$
(5)

III. T^2 CONTROL CHART OF HOTELLING

One of the most known control schemes to detect deviations in the mean of multivariate processes I the T^2 control chart of Hotelling[10]. When the mean vector $\boldsymbol{\mu}_0 = (\mu_{01}, \mu_{02})$ and the matrix $\boldsymbol{\Sigma}$ are known, the T^2 monitoring statistics of Hotelling is represented by:

$$T^{2} = \left(\mathbf{X} - \boldsymbol{\mu}_{0}\right)^{T} \Sigma^{-1} \left(\mathbf{X} - \boldsymbol{\mu}_{0}\right) \tag{6}$$

With the process in control, $T^2 \sim \chi_p^2$, if occurs a special cause that induces change in the mean vector for μ_1 =(μ_{11} , μ_{12}), $T^2 \sim \chi_{(p,\lambda)}^2$ with non-centrality parameter $\lambda^2 = \delta \Gamma_{\overline{\chi}}^{-1} \delta$, being

$$\delta = (\delta_1 = \mu_{11} - \mu_{01}, \delta_2 = \mu_{12} - \mu_{02})$$
, see Liu et al.[22]. When the mean vector and the covariance matrix are unknown and must be estimated, the control limits are calculated according to the monitoring phase [23].

Some authors [24, 25, 26,]use the non-centrality parameter (λ^2) as a displacement measure in the process mean vector. In this case, the chart performance is measured by:

$$ARL = \left\{ 1 - \left[\Pr\left(\chi_{(p,\lambda)}^2\right) < LC \right] \right\}^{-1}$$
(7)

where: ARL is the average number of samples up to the signal; CL is the control limit of the T^2 chart. The ARL measures the average number of samples until the occurrence of a false alarm if $\lambda^2=0$. When the process is out of control, the chart with the smallest ARL detects faster a process change.

<u>www.ijaers.com</u> Page | 127

IV. AUTOCORRELATION EFFECT IN BIVARIATE PROCESSES

To he used when the independence hypothesisamong observations of one or more quality characteristics is not violated, the Hotelling T^2 chart was designed. Excluding the effect of this hypothesis is quite detrimental to the control chart performance. To study the autocorrelation effect, it was considered the distance from X vector μ mean vector Mahalanobis distance [27]. The Mahalanobis distance is given by:

$$D^{2} = (\mathbf{X} - \boldsymbol{\mu}_{0})' \Sigma^{-1} (\mathbf{X} - \boldsymbol{\mu}_{0})$$
(8)

Ratio between cross-covariance matrix (Γ) and the elements of matrices Φ and Σ is calculated using equation (3). In presence of autocorrelation and correlation, the Mahalanobis distance is given by:

$$D^{2} = (\mathbf{X} - \boldsymbol{\mu}_{0})' \Gamma^{-1} (\mathbf{X} - \boldsymbol{\mu}_{0})$$
(9)

Without generality loss, considering bivariate

case where
$$\Phi = \begin{bmatrix} a & 0 \\ 0 & b \end{bmatrix}$$
 and
$$\Sigma = \begin{bmatrix} 1 & \rho \\ \rho & 1 \end{bmatrix}$$
, when $\mu_0 = (\mu_{01} = 0; \mu_{02} = 0)$

and the vector $\mathbf{X} = (x; y)$ the distance D^2 is equivalent to:

$$D^{2} = \frac{\left(-a^{3}bx^{2} + 2\rho a^{2}b^{2}xy + a^{2}x^{2} - 2\rho a^{2}xy - ab^{3}y^{2} + abx^{2} + aby^{2} - 2\rho b^{2}xy + b^{2}y^{2} - x^{2} + 2\rho xy - y^{2}\right)}{\left(ab - 1\right)^{-1}\left(-a^{2}b^{2}\rho^{2} + a^{2}b^{2} + a^{2}\rho^{2} - 2ab + b^{2}\rho^{2} - \rho^{2} + 1\right)}$$
(10)

Equation (10) reveals influence of a , b e ho in distance D^2 .

If a=b=0, namely, $\Phi=0$ (there is no autocorrelation), the distance D^2 is reduces to:

$$D^{2} = (x^{2}-2\rho xy+y^{2})/(1-\rho^{2})$$
(11)

When there is no autocorrelation, that is, data are independent $D^2 \sim \chi^2_{(p;\alpha)}$. To evaluate the autocorrelation effect, it was used in this article the bivariate case and $\alpha=0.01$ ($\chi^2_{(p=2;\alpha=0.01)}$), where $D^2=10.5966$.

When there is no displacement, the process is in statistical control. The performance of a control chart can be assessed in terms of number of samples that the chart uses to detect a shift in the characteristic to be monitored. It is expected in this case the signal given by the chart to be a false alarm. The value $D^2=10.5966$ amounts to a false alarm, on average, for each 200 samples evaluated when using the Hotelling T^2 chart [28,29].

In sections 4.1 and 4.2, there was the evaluation of effect autocorrelation of process in control ($\delta=0$) and process out of control ($\delta\neq0$), respectively. At the graphical evaluation of autocorrelation effect, it was considered that the displacement is type $\delta=\left(\delta_1=\mu_{11}-\mu_{01},\delta_2=\mu_{12}-\mu_{02}\right), \quad \text{ie,} \quad \text{the occurrence of a special cause shifts the mean vector}$ $\mu_0=\left(\mu_{01}=0;\mu_{02}=0\right)\text{to} \quad \text{a} \quad \text{new} \quad \text{level}$ $\mu_1=\left(\mu_{01}+\delta_{1\mu};\mu_{02}+\delta_{2\mu}\right).$

4.1 Graphical evaluation of autocorrelation effect with process in control

In a process free of autocorrelation, a=b=0 and $\rho=0.7$, it follows that $D^2=1.9608x^2-2.7451xy+1.9608y^2$. The ellipse representing the distribution contour line for $D^2=10.5966$ is illustrated in Figure 1. Figure 2 illustrates the contour line for a=b=0.5 and $\rho=0.7$.

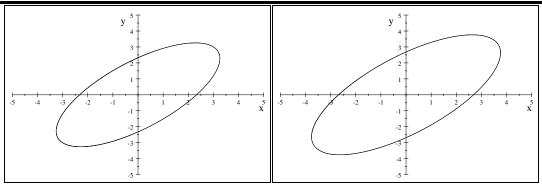


Fig.1: Ellipse: a = b = 0 e $\rho = 0.7$. Figure 2. Ellipse: a = b = 0.5 e $\rho = 0.7$.

Source: The authors. Source: The authors.

For a and $b \in \{0.0; 0.1; 0.2; 0.3; 0.4; 0.5; 0.6; 0.7; 0.8; 0.9\}$, it can be observed in Figure 3 a graphic demonstration in which the greater the autocorrelation, the greater the elliptical area, that is, if the process is in control and there is autocorrelation in variables, it is necessary to adjust the graphical control limit otherwise, many false alarms will occur.

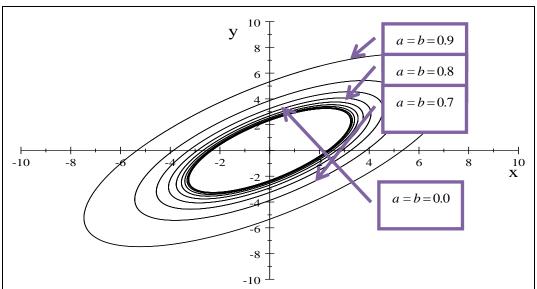


Fig.3: Ellipses: a and $b \in \{0.0; 0.1; 0.2; 0.3; 0.4; 0.5; 0.6; 0.7; 0.8; 0.9\}$ and $\rho = 0.7$.

Source: The authors.

Ellipses in Figure 3 represent all equidistant points, in Mahalanobis distance, from the origin, if the data are normally distributed,. This suggests that all these points are equally likely to be governed by a multivariate normal distribution centered at (0,0), for $\mu_0 = 0$. In T^2 Hotelling chart, the control limit (CL) equal to $D^2 = 10.5966$, generates, generally, a false alarm every 200 samples collected when a = b = 0. Not so when $a = b \neq 0.0$, that is, the average false alarm rate does not correspond to an alarm every 200 samples collected, even if it is used as the CL value 10.5966. This means in practice that, when one uses the Hotelling T^2 chart, to consider the chart CL with chi-square distribution with p

degrees of independence $\left(\chi^2_{(p)}\right)$ in autocorrelation presence will provide with a false alarms rate different than the desired.

4.2 Graphical evaluation of autocorrelation effect with the process out of control

In Figure 4, it is illustrated a zero-autocorrelation process with a=b=0 and $\rho=0.7$. The dashed ellipse with center (0,0) is a process in control and its equation is $D^2=1.9608x^2-2.7451xy+1.9608y^2=10.5966$. The other ellipses represent the occurrence of a special cause that moves the mean vector towards a new baseline:

a) Displacement
$$1 \rightarrow \mu_1 = (\mu_{01} + 1; \mu_{02} + 1)$$
; and:

$$D^2 = 1,9608x^2 - 2.7451xy - 1.1765x + 1.9608y^2$$

Displacement 2
$$\rightarrow \mu_1 = (\mu_{01} + 2; \mu_{02} + 2);$$
 and:

 $D^2 = 1.9608x^2 - 2.7451xy - 2.3529x + 1.9608x^2 - 3529x + 1.9608x^2 - 3529x + 1.9608x^2 - 2.7451xy - 2.3529x + 1.9608x^2 - 3529x + 1.9608x^2 - 3529x^2 - 3520x^2 -$

b) Displacement 3
$$\rightarrow \mu_1 = (\mu_{01} + 3; \mu_{02} + 3);$$

and:

$$D^2 = 1.9608x^2 - 2.7451xy - 3.5294x + 1.9608y^2$$

In Figure 5, it is displayd a process with autocorrelation with a = b = 0.7 and $\rho = 0.7$. The dashed ellipse with center in (0,0) is a process control and its equation is: $D^2 = x^2 - 1.4xy + y^2 = 10.06$. The value of 10.06 was used in order to make a fair comparison that, in autocorrelation presence, maintains the average false alarm rate equal to an alarm every 200 samples. As demais elipses representam a ocorrência de

uma causa especial que desloca o vetor de médias para um novo patamar: The other ellipses represent the occurrence of a special cause that moves the mean vector

a) Displacement
$$1 \rightarrow \mu_1 = (\mu_{01} + 1; \mu_{02} + 1)$$
; and:
$$D^2 = x^2 - 1.4xy - 0.18x + y^2 - 0.18y + 0.054 = 1$$

$$D^{2} = 1.9608x^{2} - 2.7451xy - 3.5294x + 1.9608y^{2} = 3.5294y + 10.588 = 10.588 = 10.5966(\mu_{01} + 2; \mu_{02} + 2);$$
Figure 5 it is displayd a process with and:

$$D^2 = x^2 - 1.4xy - 0.36x + y^2 - 0.36y + 0.216 = 1$$

c) Displacement 3
$$\rightarrow \mu_1 = (\mu_{01} + 3; \mu_{02} + 3);$$

and:

$$D^2 = x^2 - 1.4xy - 0.54x + y^2 - 0.54y + 0.486 =$$

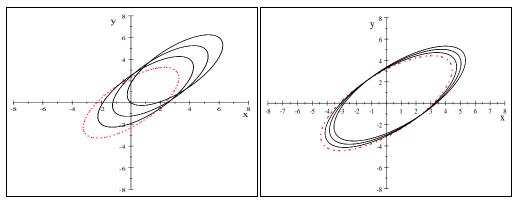


Fig.4: Ellipses: a = b = 0 and $\rho = 0.7$. Figure 5-Ellipses: a = b = 0.7 and $\rho = 0.7$. Source: The authors. Source: The authors.

One can note, in Figure 4, that in processes without autocorrelation the displacement in mean vector caused by a special question is represented by ellipses which depart from the center (0,0), indicating that the T^2 chart, in this case, presents superior performance in relation to the case where autocorrelation is present. In Figure 5, the ellipses have a higher resistance to remain close to the center (0,0) when occur displacements that disturb the mean vector, meaning that the T^2 chat performance is lower when the autocorrelation is present.

4.3 Example

It was simulated two types of bivariate processes and T^2 chart applied to control the variables of these processes. In the first case: $\mu_0 = (0; 0)$; a=b=0.0; = 0.7

CL=10.5966 (ARL₀=200). In the second case: $\mu_0 = (0; 0); a=b=0.7; =0.7 e CL=10.06 (ARL_0=200).$ Three kinds of displacements were performed at the mean vector: $\delta = (1.0; 1.0)$, $\delta = (2.0; 2.0)$ and

 $\delta = (3.0; 3.0)$. Variables observations of the first and second processes were generated with the models of equation (1) and equation (2), respectively. Figures 6, 7 and 8 show the results. In each T^2 chart, the process has displacements in the mean vector from the sample 50. The results show that autocorrelation decreases the chart power to detect a special cause which operates in the mean vector of the process. Similar results were illustrated in Figures 4 and 5.

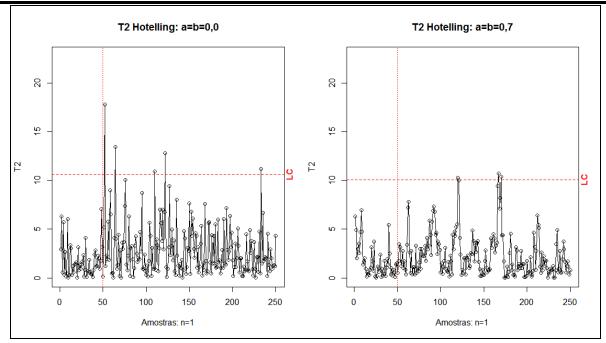


Fig.5 – Hotelling T^2 charts; $\delta = (\delta_1 = 1.0; \delta_2 = 1.0)$.

Source: The authors.

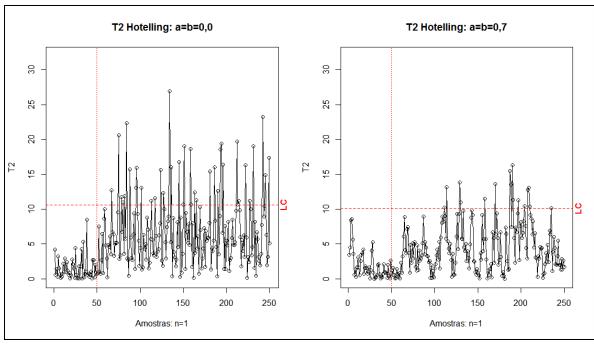


Fig.6 – Hotelling T^2 charts; $\delta = (\delta_1 = 2.0; \delta_2 = 2.0)$.

Source: The authors.

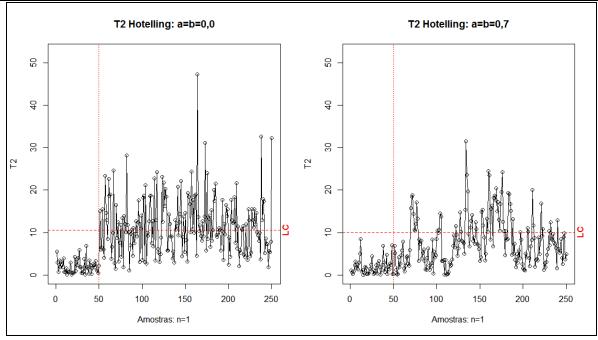


Fig.7 – Hotelling T^2 charts; $\boldsymbol{\delta} = (\delta_1 = 3.0; \delta_2 = 3.0)$.

Source: The authors.

V. CONCLUSION

It has been evaluated, in this article ,the autocorrelation effect in a T^2 control chart since it is one of the most popular tools in academia and industry. The Mahalanobis distance, the same statistic used in the T^2 chart, was used to represent geometrically a process behavior in presence and absence of special causes that affect the average value of the monitored variables.

The T^2 chart performance is affected by the autocorrelation hypothesis violation, reducing the ability to detect deviations in the mean vector. The use of ellipses illustrated how the data of a process behave in presence of autocorrelation, that is, the masking displacement effect in the mean vector of variables. The displayed examples illustrated reduction that occurs in power T^2 chart to detect the presence of a special cause that shifts in the process mean vector. It is suggested, in future works, presentation of statistics or techniques that improve control chart in presence of autocorrelation.

REFERENCES

- [1] Joe H. Sullivan& William H. Woodall (1996) A Comparison of Multivariate Control Charts for Individual Observations, Journal of Quality Technology, 28:4, 398- 408, DOI: 10.1080/00224065.1996.11979698.
- [2] Walid Gani, Mohamed Limam, Performance Evaluation of One-Class Classification-based

- Control Chartsthroughan Industrial Application, **Quality and Reliability Engineering International**, Volume 29, Issue 6, October 2013, Pages 841-854, https://doi.org/10.1002/qre.1440.
- [3] Jeffrey E. Jarrett&Xia Pan (2007) Monitoring Variability and Analyzing Multivariate Autocorrelated Processes, Journal of Applied Statistics, 34:4, 459-469, DOI: 10.1080/02664760701231849.
- [4] Shichang Du,Xufeng Yao, Delin Huang, Meng Wang, Three-dimensional variation propagation modeling for multistage turning process of rotary workpieces, Computers & Industrial Engineering, Volume 82, April 2015, Pages 41-53, https://doi.org/10.1016/j.cie.2015.01.010.
- [5] A Mitra, M Clark, Monitoring variability of multivariate processes, International Journal of Quality Engineering and Technology, Volume 4, Issue 2, 2014, https://doi.org/10.1504/IJQET.2014.060431.
- [6] Bruno Chaves Franco, Giovanni Celano, Philippe Castagliola, Antonio Fernando Branco Costa, Economic design of She whart control charts for monitoring auto correlated data with *skip* sampling strategies, *International Journal of Production Economics*, Volume 151, May 2014, Pages 121-130, https://doi.org/10.1016/j.ijpe.2014.02.008.
- [7] Pei-His Lee, Chau-Chen Torng, Li-Fang Liao, Aneconomic design of combined double sampling and variable sampling interval X⁻ control chart,

- International Journal of Production Economics, Volume 138, Issue 1, July 2012, Pages 102-106, https://doi.org/10.1016/j.ijpe.2012.03.006.
- [8] Xue Long Hu, Philippe Castagliola, Jinsheng Sun, Michael B.C. Khoo, The Effect of Measurement Errorson the Synthetic Chart, Quality and Reliability Engineering International, Volume 31, Issue 8, December 2015, Pages 1769-1778, https://doi.org/10.1002/qre.1716.
- [9] Pan, X. &Jarrett, J.E. Qual Quant (2012) 46: 935. https://doi.org/10.1007/s 11135-011-9437-x.
- [10] Hotelling, H. Multivariatequalitycontrol illustrated by the airtesting of samples bombs sights, in techniques of Statistical Analysis, Eisenhard C.; Hastay, M. W.; Wallis, W. A., ed., Mc Graw Hill, New York, p. 111-184, 1947.
- [11] Chen, Y. K. Adaptives ampling enhancement for Hotelling's T2charts. European Journal of Operational Research, v. 178, n. 3, p. 841-857, 2007.
- [12] Chen, Y. K.; Hsieh, K. L. Hotelling's T2charts with variable samplesize and control limit. **European Journal of Operational Research**, v. 182, p. 251–1262, 2007.
- [13] Xuan Huang, Søren Bisgaard, Nuo Xu, Model-based Multivariate Monitoring Charts for Autocorrelated Processes, Quality and Reliability Engineering International, Volume 30, Issue 4, June 2014, Pages 527-543, https://doi.org/10.1002/qre.1506.
- [14] Xia Pan, Jeffrey Jarrett, Using vector autoregressiveresidualsto monitor multivariate processes in the presence of serial correlation, International Journal of Production Economics, Volume 106, Issue 1, March 2007, Pages 204-216, https://doi.org/10.1016/j.ijpe.2006.07.002.
- [15] Bahar Biller, Copula-BasedMultivariate Input Models for StochasticSimulation, **Operations**Research, Volume 57, Issue 4, July-August 2009, Pages iii-1055, https://doi.org/10.1287/opre.1080.0669.
- [16] Seoung Bum Kim, Weerawat Jitpitaklert & ThunteeSukchotrat (2010) One-Class Classification-Based Control Charts for Monitoring Autocorrelated Multivariate Processes, Communications in Statistics SimulationandComputation, 39:3, 461-474. DOI: 10.1080/03610910903480826.
- [17] Ben Khediri Issam, Limam Mohamed, Support vector regressionbased residual MCUSUM controlchart for autocorrelated process, **Applied Mathematics and Computation,** Volume 201, Issues 1–2, 15 July 2008, Pages 565-574, https://doi.org/10.1016/j.amc.2007.12.059.

- [18] H. Brian Hwarng &Yu Wang (2010) Shift detection and source identification in multivariate autocorrelated processes, International Journal of Production Research, 48:3, 835-859, DOI: 10.1080/00207540802431326.
- [19] Pfaff, B. VAR, SVAR and SVEC models: implementation within r package vars. **Journal of Statistical Software**, v. 27, n. 4, p. 204- 216, 2008.
- [20] Yanfen Shang, Fugee Tsung & Changliang Zou (2013) Statistical process control for multistage processes with binary outputs, IIE Transactions, 45:9, 1008-1023, DOI: 10.1080/0740817X.2012.723839.
- [21] Roberto Campos Leoni, Antônio Fernando Branco Costa, Marcela Aparecida Guerreiro Machado, THE PRESENCE OF AUTOCORRELATION ON THE T2 CONTROL CHART OF HAROLD HOTELLING, Systems & Management 12 (2017), pp 252-259, DOI: 10.20985/1980-5160.2017.v12n3.659.
- [22] Liping Liu, Miaomiao Yu, Yizhong Ma, Yiliu Tu, Economic and economic-statistical designs of an X⁻ control chart for two-unit series systems with condition-based maintenance, **European Journal of Operational Research**, Volume 226, Issue 3, 1 May 2013, Pages 491-499, https://doi.org/10.1016/j.ejor.2012.11.031.
- [23] Bersimis, S.; Psarakis, S; Panareos, J. Multivariate Statistical Process Control Charts: An Overview.Quality and Reliability Engineering International, v. 23, p. 517-543, 2007.
- [24] Alt, F. B. Multivariate control charts. Encyclopedia of Statistical Sciences. Kotz, S.; Johnson, N. L. Eds., Wiley, 1985.
- [25] Aparisi, F. Hotelling's T2control chart with adaptive sample sizes. **International Journal of Production Research**, v. 34, p. 2853-2862, 1996.
- [26] Faraz, A., Chalaki, K. & Moghadam, M.B. Qual Quant (2011) 45: 579. https://doi.org/10.1007/s11135-010-9314-z
- [27] Mahalanobis, P. C. In Proceedings National Institute of Science, India, v. 2, n.1, p. 49-55, 1936.
- [28] Costa, A. F. B.; Epprecht, E. K.; Carpineti, L. C. R. Controle Estatístico de Qualidade, 2ª. ed., São Paulo: Editora Atlas, 2008.
- [29] Roberto Campos Leoni, Marcela Aparecida Guerreiro Machado, Antonio Fernando Branco Costa, Simultaneous Univariate X_bar Chartsto Control Bivariate Processes with Autocorrelated Data, Qualityand Reliability Engineering International, Volume31, Issue8, December 2015, Pages 1641-1648, https://doi.org/10.1002/qre.1697